


Height Gage
Optional Accessories for Height Gages

SPECIFICATIONS (Scriber)

Metric	
Code No.	Applicable Height Gages
07GZA000	192 Series Digimatic Height Gages (192-613-10, 192-614-10, 192-615-10)
	570 Series Digimatic Height Gages (570-302, 570-304)
	192 Series Dial Height Gages (192-130, 192-131, 192-132, 192-133)
	514 Series Vernier Height Gages (514-102, 514-104, 514-106, 514-103, 514-105, 514-107)
	570 Series Digimatic Height Gages (570-402/404)
900168	514 Series Vernier Height Gages (514-160/172)
905200	192 Series Digimatic Height Gages (192-663-10, 192-664-10, 192-665-10)
	570 Series Digimatic Height Gage (570-230)
	514 Series Vernier Height Gages (514-108, 514-109)
900390	514 Series Vernier Height Gage (514-170)
Inch	
Code No.	Applicable Height Gages
900173	570 Series Digimatic Height Gages (570-227, 570-244)
	506 Series Vernier Height Gages (506-201/207/204, 506-208)
900258	192 Series Digimatic Height Gages (192-630-10, 192-631-10, 192-632-10, 192-633-10)
	570 Series Digimatic Height Gages (570-412, 570-413, 570-414)
	574 Series Heightmatic (574-212-1, 574-211-1, 574-210-1)
905201	192 Series Digimatic Height Gages (192-670-10, 192-671-10, 192-672-10, 192-673-10)
	570 Series Digimatic Height Gage (570-248)

DIMENSIONS (Scriber)

Unit: mm

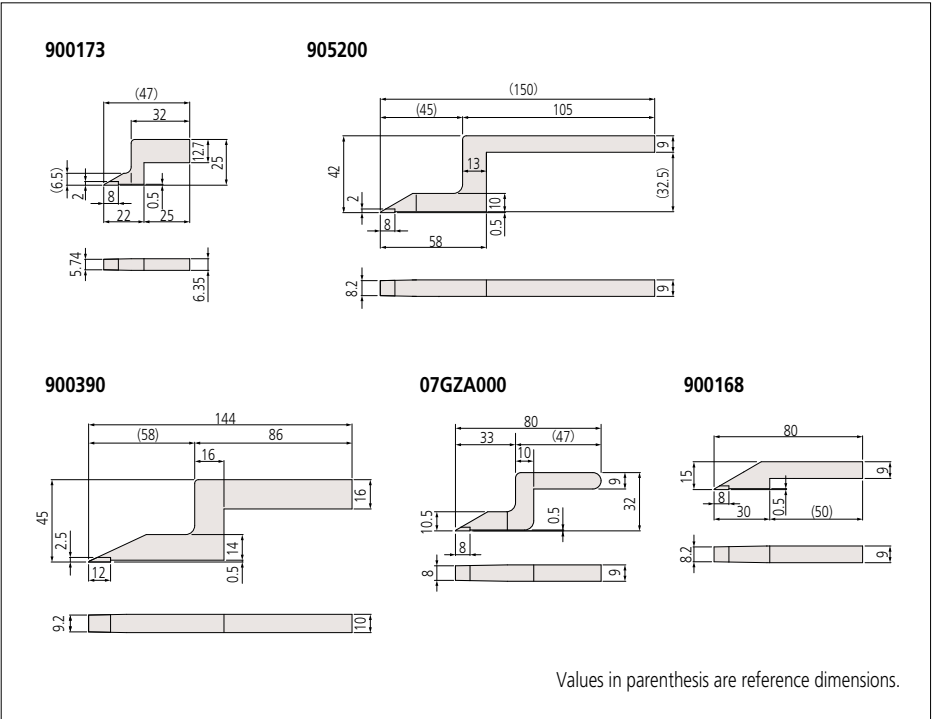

Values in parenthesis are reference dimensions.

Height Gage

Height Gage Optional Accessories for Height Gages

Dial Test Indicators

- For information about the attachment of dial test indicators, refer to page 07-84.

Contact Sensor



900872

- This is a convenient sensor to be attached to both the workpiece*¹ and the height gage*², giving a lamp display when the scribe touches the workpiece.
*1 Conductive workpieces only.
*2 Attach to a conductive part.
- Magnet is incorporated.
- Battery (PR44, 2 pcs. required) is not included.
- Use it on a precision black granite surface plate. (Refer to page 01-51)

Center Probe



951144

- Allows quick measurement of center-to-center distance between holes.
- Measurable hole diameters: 1 to 38 mm
- Mounting bar section: 9x9 mm

Depth Gage Attachment



900764

- Attaches to a height gage for measuring groove and hole depth.
- Minimum hole diameter: 5.5 mm
- Maximum distance from the bottom of the holding bar to the contact point: 80 mm (metric type), 2.95 in (inch type)
- Dial indicator contact points are usable. (Refer to pages 07-63 and 07-64.)
- Mounting bar section: 9x9 mm
- Holding bar length: 100 mm